

## SMA Right angle connector assembly instructions

Specificatin No.	Connector	Cable type	
SH070227-01	AX-219LP, AX-358LP	SC-219/50, SC-358/50 series	

Supplied parts




G

Body

Screw lid

## 1. Strip cable


Strip center conductor 3.0mm per diagram.
Do not damage center conductor.
Cut cable end needs to be plain.





- 2-1 . Slide cable into connector until it stops.
- $2\hbox{--}2$  . Solder the body onto the cable.



4. Put a lid on.



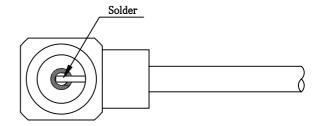

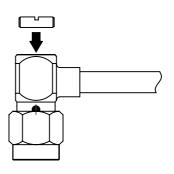

1/1

\* Please try to solder in a short time.

Date	Drawn	Checked	Approved
28.Mar.2017	Kasai	Seino	Kasai